

# Release note

Product: TR311HWV2/TR313V2/TR323NV2/TR333V2

FW version	V0.1.0000	.69							
Release	2024/10/28								
date									
New	1. Able to enable the NDI HX2 through FW upgrade and without any activation process.								
feature	*Remar	k: Deactivatio	n requires do	owngrading o	of	the firmware	•		
		Built-in ND							
	Video Ba	andwidth							
	Low	•	<b>O</b> High						
	_								
Improvement	_	: Optimize 108	=	=	er	n connected to	o ZOOMROO	M for Intellig	gent
		or or Smart gal	•						
	Remari	k: Changing th	e priority mo	oae requires	а	camera reboo	ot.		
	2. Redefir	ne the hostnar	ne logic to u	se the mode	l's	name combi	ned with the	last 6 digits of	of
	the MAC address.								
	Note: \	Note: When upgrading an existing TR535 camera to FW V47, the hostname will remain							
	unchar	nged. However	, once the "[	Default" opti	or	n is executed o	on the OSD, t	he hostname	5
	will up	date to the mo	odel's name	combined wi	ith	n the last 6 dig	gits of the MA	AC address.	
	Remark: Change video theme mode requires camera reboot.								
	Model Na	me TR315N	Hostname	•					
	IP Addres Serial Nu		TROACN	l-106e2b					
	MAC Add Firmware		CONTRACTOR OF						
	Tilliwale	VGISIOIT 0.0.0000.4	,						
	3. Stream Video Output: Change the default Bitrate setting from 4Mbps to "Auto" to								
	improv	e video qualit	у.				•		
	-	L: When upgra	•	ting camera t	to	FW V47, the	Bitrate settin	g will remain	1
	uncha	anged. Howeve	er, once the '	'Default" opt	tic	on is executed	on the OSD,	the Bitrate w	vill
	be up	dated to "Auto	o."	•					
	Note	2: The default	"Auto" Bitra	te will be con	ηfi	igured accordi	ing to differe	nt resolution	s as
	show	n in the follow	ing table.						
		Non	-NDI Theme r	node		NIT	OI Theme mod		7
	Resolution	60FPS	30FPS	<30FPS	H	60FPS	30FPS	<30FPS	-
	Resolution	U265.22NA	H26E-16M	136E-0M	Н	HJCE-ECM	DUFF3	HJGE-EGM	-

	Nor	Non-NDI Theme mode			NE	OI Theme mod	le
Resolution	60FPS	30FPS	<30FPS		60FPS	30FPS	<30FPS
2160p	H265:32M H264:64M	H265:16M H264:32M	H265:8M H264:8M			H265:56M H264:56M	H265:56M H264:56M
1080p	H265:16M H264:16M	H265:8M H264:8M	H265:4M H264:4M		H265:40M H264:40M	H265:40M H264:40M	H265:40M H264:40M
720p	H265:8M H264:8M	H265:4M H264:4M	H265:2M H264:2M		H265:24M H264:24M	H265:24M H264:24M	H265:24M H264:24M





	Non-ND		-NDI Theme r	node	ND		OI Theme mod	le	
	Resolution	60FPS	30FPS	<30FPS		60FPS	30FPS	<30FPS	
	540p	H265:8M H264:8M	H265:4M H264:4M	H265:2M H264:2M		H265:20M H264:20M	H265:20M H264:20M	H265:20M H264:20M	
	480p	H265:4M H264:4M	H265:2M H264:2M	H265:1M H264:1M		H265:12M H264:12M	H265:12M H264:12M	H265:12M H264:12M	
	360p	H265:2M H264:2M	H265:1M H264:1M	H265:512K H264:512K		H265:12M H264:12M	H265:12M H264:12M	H265:12M H264:12M	
Know issues	the Chro  2. There is within the version.	ome browser a possibility ne system to As a result, c	on Apple de of firmware enhance aut luring the up	vices for the update failur co-tracking pendate process	n e er	e Apple MAC neantime.  due to signification formance in the	cant modifica his particular nce of interm	ations made r firmware	





FW version	V0.1.0000.65
Release	2024/09/20
date	
New	N/A
feature	
Improvement	4. Optimize video quality when connected to UE1 and MT300N (enhance I-Frame stability).
Know issues	3. Web GUI has known compatibility issue with the Apple MAC Safari browser. Please use the Chrome browser on Apple devices for the meantime.
	4. There is a possibility of firmware update failure due to significant modifications made within the system to enhance auto-tracking performance in this particular firmware version. As a result, during the update process, there is a chance of intermittent failures. In the event of a failure, please attempt the update process again.





FW version	V0.1.0000.64
Release	2024/05/24
date	
New feature	<ol> <li>Supports Zoom Room's new feature "Presenter Focus." When "Presenter Focus" is enabled, the camera will start auto-tracking; when it is disabled, the camera will stop auto-tracking.         Note 1: This feature is only supported on TR313V2, TR323NV2.         Note 2: Zoom certification is still in process. This information is not yet listed on the Zoom Rooms Certified Hardware page. The announcement will be made by June. (It is recommended to start using Presenter Focus by June.)         Note 3: Zoom Rooms support starts with version 6.0.10     </li> </ol>
	Camera Mode  Manual  Manual  Manual  More Effect Apply reflection effect to self view locally  25-VD-Lab-2  2. Supports Bosch's new version of ONVIF: DICENTIS Conference System 5.0.
	3. Supports setting ONVIF presets for Bosch's CCS 1000 D Digital Discussion System.
Improvement	<ol> <li>Optimized Camera Setup Webpage Log-In Password Rules:         <ol> <li>Password Length: Passwords must be between 8 to 32 characters long.</li> <li>Mixed Characters: Passwords should include a mix of numbers and English letters.</li> <li>Password and Account Name: The password must not be the same as the account name.</li> <li>Supported Characters:</li></ol></li></ol>
	control protocol.
	3. Bug fix to prevent image instability (tilt control hunting) at distances under 1 meter. The
	recommended operating distance is over 3 meters.





#### **Know** issues

- 5. Web GUI has known compatibility issue with the Apple MAC Safari browser. Please use the Chrome browser on Apple devices for the meantime.
- 6. There is a possibility of firmware update failure due to significant modifications made within the system to enhance auto-tracking performance in this particular firmware version. As a result, during the update process, there is a chance of intermittent failures. In the event of a failure, please attempt the update process again.






Product: TR	311HWV2/TR313V2/TR323NV2/TR333V2
FW	V0.1.0000.59
version	2024/04/05
Release date	2024/01/05
New	NA
feature	
Improvement	4. Optimized the tracking detection sensitivity for seamless switching between a single
	presenter and multiple presenters.
	5. Optimized the Auto Tracking camera operation for smoother following of the presenter's
	movements.
	6. Bug fixed where HTTPS was incorrectly turned on after resetting to factory default
	settings; it should have been turned off.
	7. Optimized the LLDP information for better integration Netgear switches.
	8. Optimized the command response of the VISCA protocol.
	9. Optimized the compatibility of UVC video.
	<ol> <li>Optimized the effective tracking area function.</li> <li>Redefine effective tracking area, the area outside the red frame is exclusive, and the auto- tracking area only operates within the red frame.</li> <li>Added a visible effective tracking area frame on HDMI output. Please follow the setup:</li> <li>Set the effective tracking area function from webpage.</li> <li>Enable the Effective tracking area function.</li> <li>Turn on the Auto Tracking function.</li> <li>A Long press the "FREEZE" button on the remote control. You will see a white frame on the HDMI output, which represents the effective tracking area frame. (Note: Long pressing the "FREEZE" button is for troubleshooting purposes only. Please disable the frame before using it, long press "FREEZE" button on remote to disable).</li> </ol>
	Tacks around the selected area, pelete configure the targeted area from the Ne view shot size of the present you choose.
Know issues	7. Web GUI has known compatibility issue with the Apple MAC Safari browser. Please use the Chrome browser on Apple devices for the meantime.
	8. There is a possibility of firmware update failure due to significant modifications made
	within the system to enhance auto-tracking performance in this particular firmware
	version. As a result, during the update process, there is a chance of intermittent failures. In
	the event of a failure, please attempt the update process again.



FW	V0.1.0000.57							
version Release	2023/11/3							
date	2023/11/3							
New	1. Able to use of the "Hostname" to activate the webpage. ( <a href="http://AVerCamera">http://AVerCamera</a> )							
feature	P.S. The hostname is o	changeable.						
	AVer Cam × +							
	← C ⊕ AVerCamera/	html/index.html?time=169822429	8047_self	中华鱼参				
	Aller	DHCP	Hostna	me				
	<b>AV</b> er	•		Camera				
	<ul><li>Live View</li></ul>	On IP Address	Off Netma:					
	Camera Settings	192.168.1.69	255.2	55.255.0				
	Video & Audio	Gateway	DNS					
		192.168.1.1	192.1	68.1.1				
	格 Network							
Improvement	11. Bug Fixed: When the tracking camera captures a large number of people, random camera							
r	image delays or freezes may occur, rendering the webpage nonfunctional.							
	12. Optimized the configuration for the "Effective Tracking Area" on the webpage.							
	13. Optimized the image focus quality of preset after switching.							
	14. Optimized the activation of Multi-presenter mode.							
	15. Optimized the UVC streaming compatibility with Zoom Room app.							
	16. Support VISCA/CGI inquiry for USB/UVC status							
	Inquiry Command	Command Packet	Reply Packet	Comments				
	USB Status	8x 09 36 69 05 FF	y0 50 00 FF y0 50 01 FF	USB cable plug out USB cable plug in				
	UVC Status	8x 09 36 69 06 FF	y0 50 00 FF	UVC stream off				
			y0 50 01 FF	UVC stream on				
	17		I					
Know issues	9. Web GUI has known of	compatibility issue with	the Apple MAC Sa	afari browser. Please use				
	the Chrome browser on Apple devices for the meantime.							
	10. There is a possibility of firmyyone undete feilure due to significant and different and differen							
	10. There is a possibility of firmware update failure due to significant modifications made within the system to enhance auto-tracking performance in this particular firmware							
	version. As a result, during the update process, there is a chance of intermittent failures. In							
	the event of a failure,	please attempt the upda	te process again.					






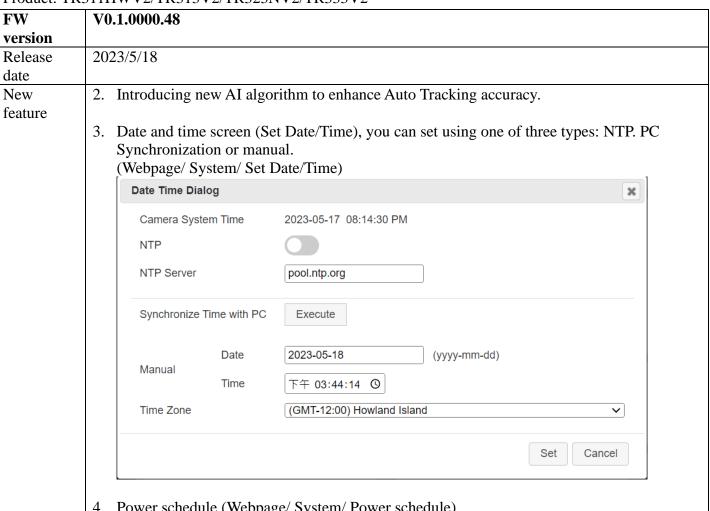

4. Power schedule (Webpage/ System/ Power schedule)

Auto reboot time, able to set a specific time for the camera to automatically reboot on a daily basis.

Powe Power Schedule: Able set a specific time for the camera to power off by simply clicking on the designated blue cell. When you click the cell and its color change from blue to grey, it indicates that the camera will automatically power off during the specified period.

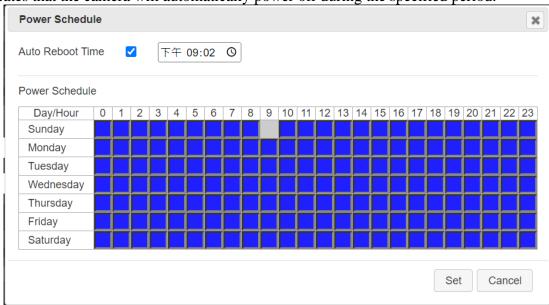

Improvement 18. Bug fixed: Resolved the issue where the effective zone was not appearing when setting the



	effective zone on the tracking page using the Firefox web browser.				
	19. Optimized UVC video performance for Barco ClickShare CX30.				
	20. Optimized gesture control finger 2 zoom in/out accuracy.				
Know issues	11. Web GUI has known compatibility issue with the Apple MAC Safari browser. Please use				
	the Chrome browser on Apple devices for the meantime.				
	12. There is a possibility of firmware update failure due to significant modifications made within the system to enhance auto-tracking performance in this particular firmware version. As a result, during the update process, there is a chance of intermittent failures. In the event of a failure, please attempt the update process again.				






Product: 11	X311HW V 2/1 R313 V 2/1 R323N V 2/1 R333 V 2
FW	V0.1.0000.43
version	
Release	2023/2/13
date	
New feature	<ol> <li>Click cursor to center position on Web page and SW: PTZ Management &amp; PTZ Control panel</li> <li>Support LLDP.</li> <li>SSHD on/off switch</li> <li>SSHD</li> <li>On Off</li> </ol> 4. HTTPS-only switch of Network page  HTTPS  Only On Off

- 5. SW\_Captureshare is able to support the Tracking camera for follows configuration:
  - 1). FW upgrade
  - 2). Tracking setting (Presenter/Zone/Hybrid)
  - 3). R/B gain
  - 4). Visible camera information, including Model name, IP address, Mac address, serial number, and FW version.

From SW\_Captureshare Version1.3.2077.0 to support those functions.



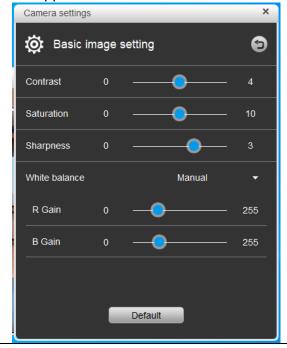








6. Add Multi-Presenter Detection VISCA command

Command Set	Command	Command Packet	Comments
Multi procentor	On	8x 01 04 A9 02 FF	
Multi-presenter	Off	8x 01 04 A9 03 FF	
Multi-presenter preset	Set	8x 01 04 AA pp FF	pp: 0x00 To 0xFF normal preset

7. Add 802.1X configuration.

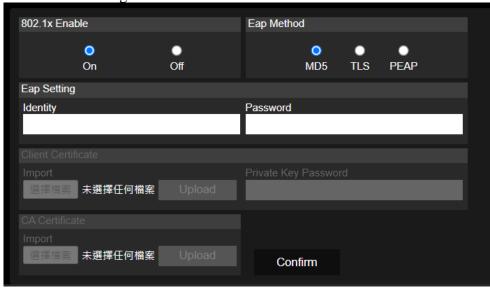


Improvement

21. Optimize zoom-in gesture functions, use "TWO" to do the zoom-in function. See the following description.





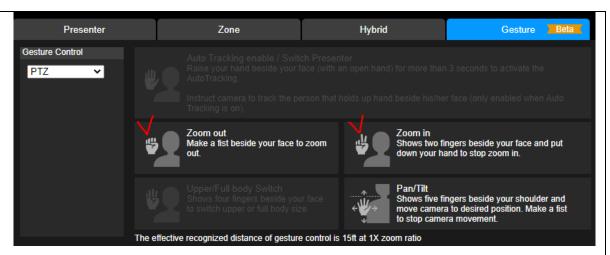

- 22. Bug, when turning on the gesture function, the preset position will shift when switching presets.
- 23. Optimize the UVC device name display when rebooting the third-party SW.
- 24. Optimize the webpage password for special Symbols.






FW	V0.1.0000.35
version	
Release	2022/8/11
date	
New	None
feature	
Improvement	25. Bug fixed: Can't return Tracking point when lose tracking.





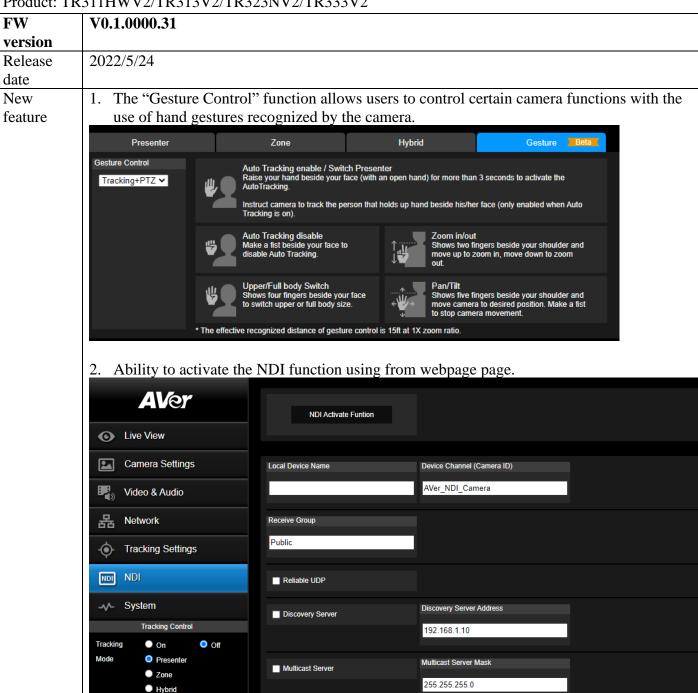

3. Ability to support LLDP (reschedule to Sep 20<sup>th</sup> to support LLDP)

Multicast Server Address

239.255.0.0

Multicast TTL

10

Ability to support HTTPS cert


Click Track



Cancel

Confirm



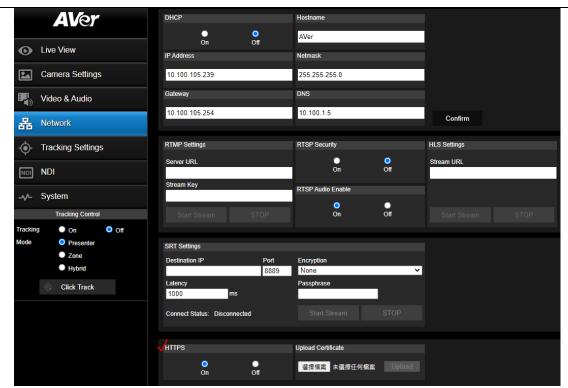


5. Ability to setting AF mode

AF Mode: If Auto Focus is selected, you can further set up the AF Mode.

Continuous AF: The camera will automatically adjust focus all the time.


AF Trigger after PTZ: The camera will automatically adjust focus every time when you perform the pan, tilt, or zoom functions.

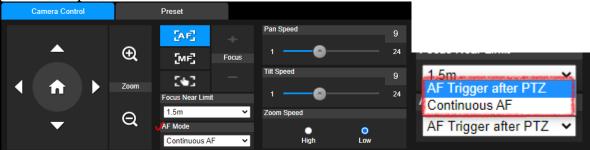

6. Allow Resolution Under 720p: Select On to allow transferring lower resolution video streaming when working with some video conference software such as Teams. It's recommended to select Off if you want to keep better image quality during video call.





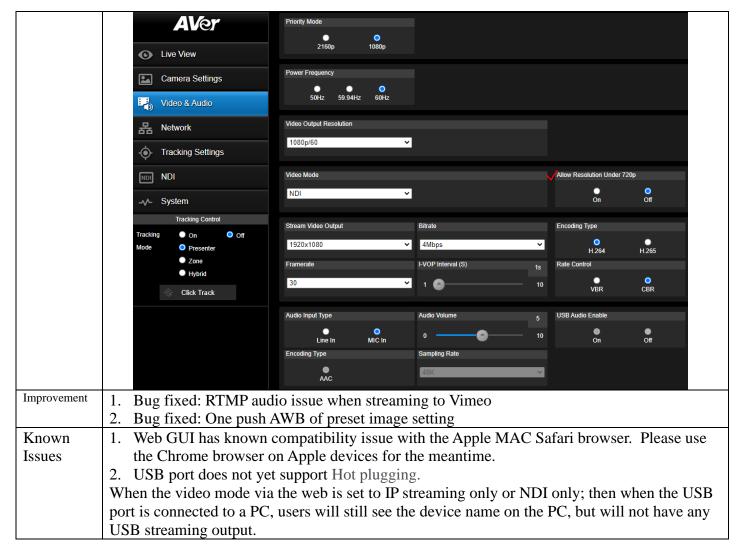





Product: TR311HWV2/TR313V2/TR333V2

